

## SERVICE BULLETIN

EOS engine

www.eos-engine.com - sales@eos-engine.com

date of release	Sept. 2018	issue 1, #0918_1_m
for engine type / applicability	alle engines with EASY-STARTER installed	
status	<b>mandatory</b>	optional

### Introduction

Due to recurred feed back from customers reporting that the starter rope on the EASY-STARTER when getting recoiled can guide into the gap between starter housing and rope spool and in consequence causes damage to starter rope and/or starter mechanism, magnet wheel and cooling fins, or even in worst case lead to engine shut-off, we saw need of a solution and modification.


### Applicability

All engines - EOS 100, EOS 100 Booster, EOS 100 Booster ICI, EOS 150 - equipped with EASY-STARTER are recommended to be modified. Engines equipped with regular starter are not effected by this service bulletin. Please note; all engines EOS 150 have been equipped with only EASY-STARTERS!

### Action

There is no need to exchange or dismount the starter for modification but to simply add a special part - the "arc adapter" - to the starter housing by placing it on the correct location by glueing. The part comes with a glue tape added already.

Mount the arc adapter to the startr housing as per pictures shown;

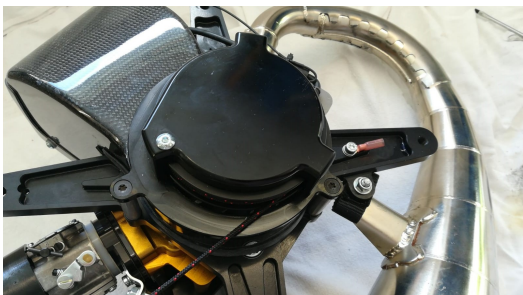

Easy-Starter before modification



clean surface with solvent




remove foil from sticky tape



place part in correct position and well press it on for permanent glueing



arc adapter finished in place

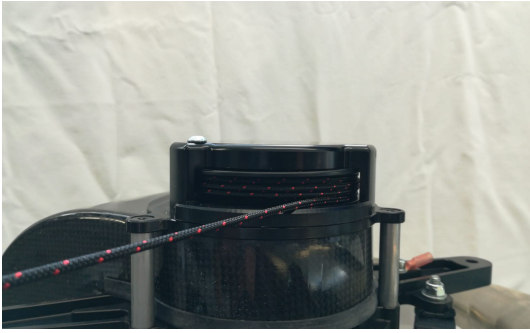

arc adapter finished in place

#### Procedure and parts availability

The subject special arc adapter part can be ordered for free from any EOS engine dealer/partner or directly from EOS engine Austria.